



## **Filling Holes and Cracks No Shrink Patch Quick Putty – Mineral Streak Black**

The Woods Company recommends using "Mineral Streak Black" No Shrink Patch-Quick to fill holes, fractured knots and voids. Please read instructions on bag first.

Each kit includes: 1-1/2 lb bag of Patch-Quick, ¼ cup measurer and ½ oz. liquid extender. Each 1-1/2 lb bag will "spot fill" approximately 500 square feet of flooring.

### **After installation, but before sanding your flooring use the following guidelines:**

1. Vacuum holes and cracks prior to beginning.
2. Using ¼ cup measurer, pour dry filler mix from the bag into a clean plastic cup (a clean butter tub will work well)
3. Mix in a smaller quantity of clean water (1/3 +/- measurer of water per each full measurer of dry mix) and stir until a thick, smooth putty consistency is reached (think thick peanut butter)
4. Work in a small area at a time. This will make it easier to keep track of the holes which have already been filled.
5. Start with small batches until you become familiar with the rate of hardening. Working time of mixed filler will be approximately 5-10 minutes.

NOTE: Add 5-6 drops Extender per ¼ cup mix to extend working time to approximately 20 mins.  
Add 8-10 drops Extender per ¼ cup mix to extend working time to approximately 30 mins.

6. Thoroughly clean your container or start with a new clean container for each batch you mix.
7. Using a flexible putty knife, fill the holes and cracks to slightly over-flowing. With practice you will find that just the right amount of pressure will "dome-up" the putty above the hole or crack that is being filled.
8. After drying for at least 3 hours (overnight suggested), the excess hardened filler may be sanded flat with the surface of the floor. The "Mineral Streak Black" wood filler will blend in well with the character and color range that is natural to the wood flooring when finished.



**FSC Supplier  
SCS-COC-002514**